Precision Ag - System 150 Firmware Upgrade Procedure

1. From the Home screen press the button beside the satellite icon on the screen to access the GPS settings screen.(3rd button down on the Left)
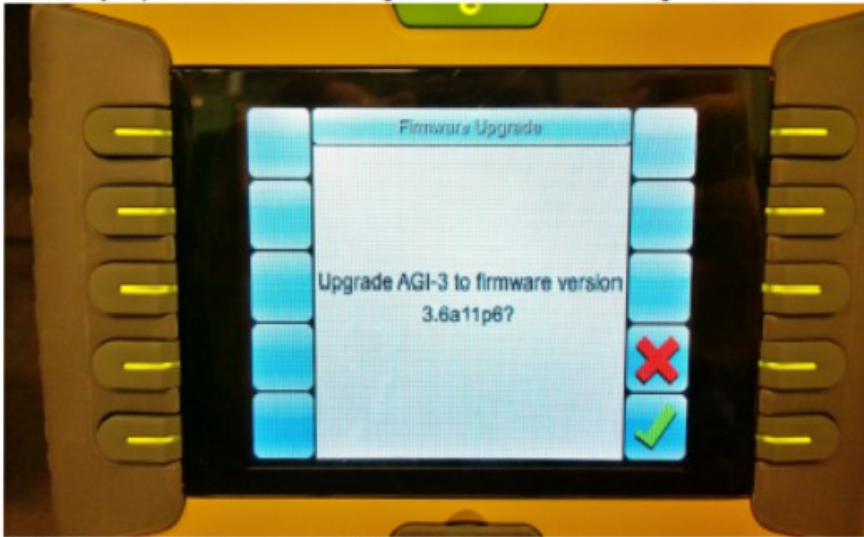
2. When on the GPS setting screen press the button beside the firmware upgrade icon.(4th button down on the Left)

3. This will bring you to the Access Code screen you code will be 1234. Enter the code by pressing the buttons by the corresponding #. After the code is enter press the button beside the green check mark in the lower right hand corner.
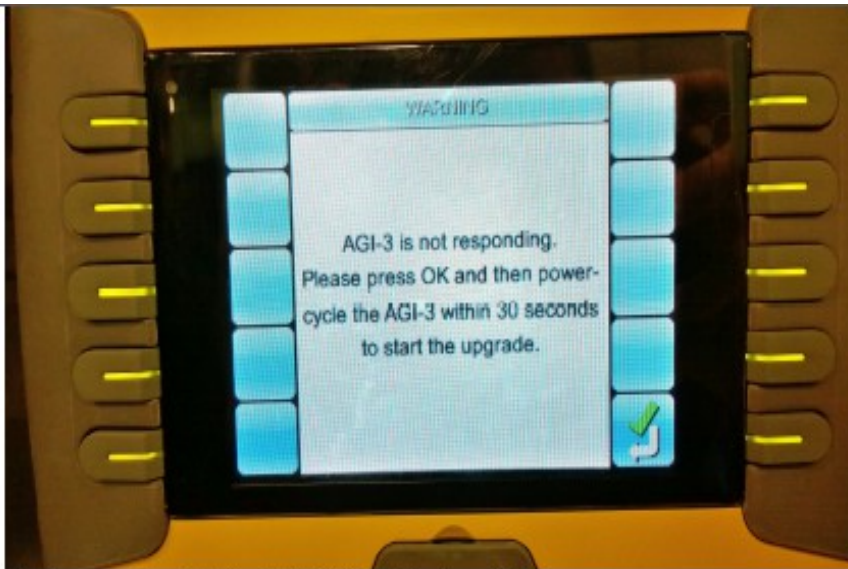
4. The Firmware Upgrade screen will then confirm that you want to upgrade the firmware to the GPS receiver. If yes, press the button beside the green check mark in the lower right hand corner.
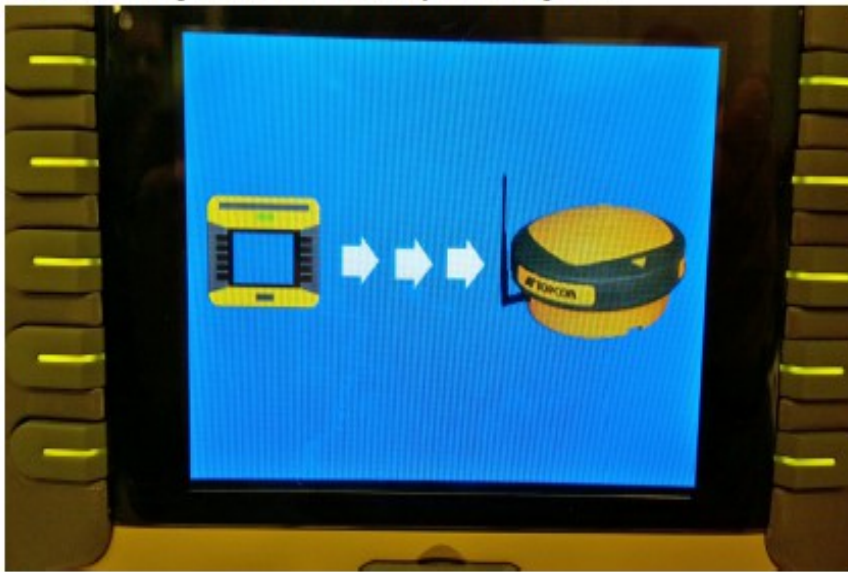

5. At this time you will want to unplug the GPS receiver.

6. The screen will give you a warning that it is not communicating with the gps receiver. Again press the button beside the green check mark in the lower left hand corner. Within 30 seconds of pressing this button plug the gps receiver back in and the firmware will begin to load.

WARNING

AGI-3 is not responding.
Please press OK and then power-
cycle the AGI-3 within 30 seconds
to start the upgrade.

7. The firmware will begin to load, this is indicated by three flashing arrows.

Included Images